

Tow-Trust Towbars


Important: Please read General Notes overleaf before fitting

Issue 13

TVW 623 Volkswagen Golf 5 Hatch 2004> Golf 6 Hatch 2009> Volkswagen Golf Plus 2005> Golf 7 Hatch 2012> Audi A3 2012> Golf SV 2014> Seat Leon 2013>

Item	Qty	Description	Item	Qty	Description
А	1	Crossmember	D	2	M16 x 50 Bolts, Nuts & S/P Washers
В	2	Side Arms	E	6	M12 x 50 Bolts & S/P Washers
С	1	Extension	F	2	M12 x 85 Bolts Grade 10.9 & Nyloc Nuts
			G	10	12 x 25 Flat Washers
			Н	4	2mm End Plate Lasers

- **1.** Remove the rear light clusters.
- 2. Remove rear bumper. Fixings along the lower edge, under each light cluster and around each wheel arch.
- 3. Remove the bumper crossbeam (this is not refitted). Replace existing bolts.
- 4. Locate Item B inside each chassis and using Item E with Item G loosely bolt to forward existing holes (these are covered with tape).
- 5. Using Item E with Item G loosely bolt Item A to Item B and through existing rearmost holes. Fully tighten all bolts.
- 6. Golf 5: Cut out a section 65mm x 125mm centrally from the lower edge of the bumper.
- 7. Golf 6: Cut out a section 65mm x 80mm centrally from the lower edge of the bumper.
- 8. Golf 7 / Audi A3: Cut out a section 65mm x 120mm centrally from the lower edge of the bumper.
- 9. Golf 7.5: No cut required.
- **10.** Leon: Cut out a section 65mm x 95mm centrally from the lower edge of the bumper.
- **11.** Refit bumper and light clusters.
- 12. Using Item F with Item G bolt Item C to Item A.
- **13.** Using Item **D** bolt the ball bracket (not supplied in this kit) to the mounting plate.

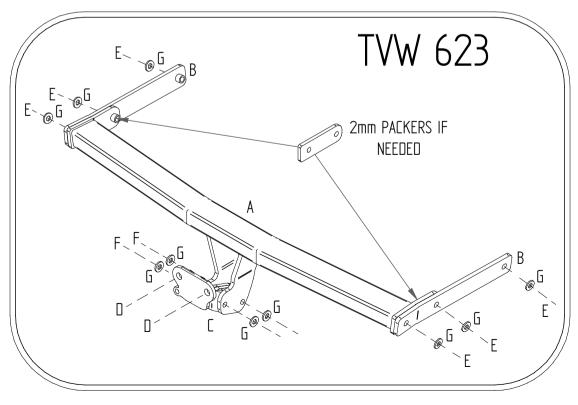

Notes:

1. Recommended Torque Setting for M12 Grade 10.9 -139 Nm. (For other Torque Settings see notes overleaf.)

2. Nose load limits and vehicle manufacturer's trailer / caravan weight limits must be observed.